




DJCONTROL IMPULSE T7  
Premium Fader Module

# INSTALLATION

**1** PDF versions:  
<https://support.hercules.com>

EN  
FR  
DE  
NL  
IT  
ES

**2** Contents

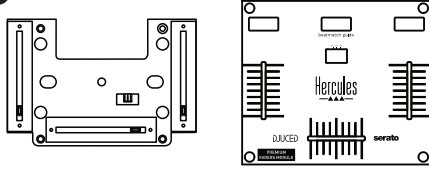


You need a Philips  
cross screwdriver




**3** Unplug T7 power  
and USB cables.


Remove volume &  
crossfader caps

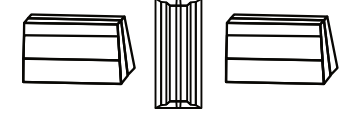


**4** Remove 4 torx   
screws, with the  
torx key

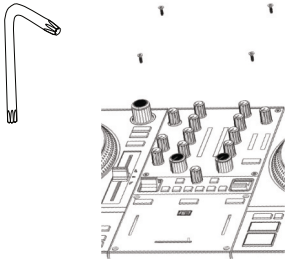


**5** Remove metal  
plate

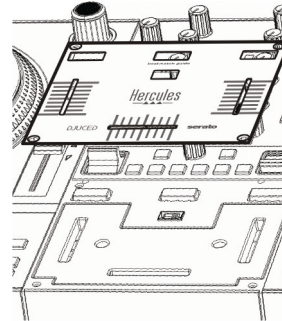


**6** Remove Philips   
(cross) screws

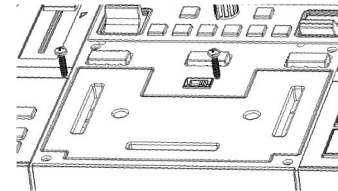


**7** Remove plastic  
plate over faders

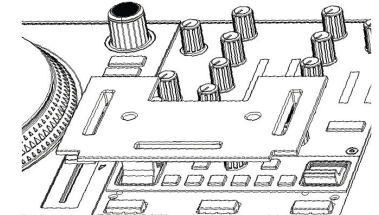


**8** Remove the faders  
power cable

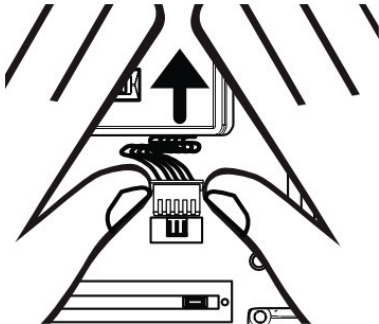


**9** Remove 4 screws  
from fader board

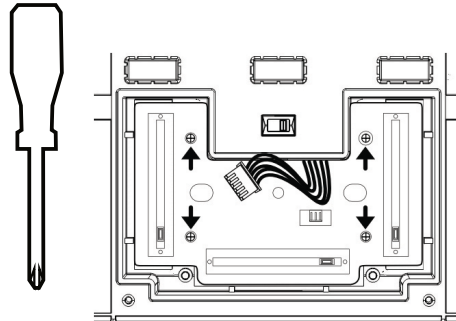


**10** Remove standard  
fader circuit board

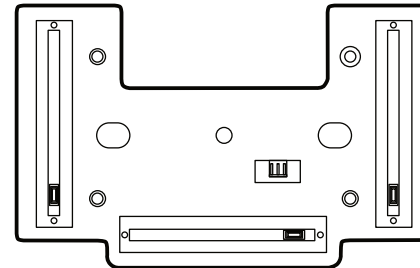


**11** Take premium  
fader (black) board

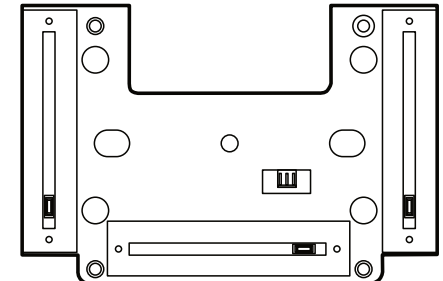


**12** Place premium fader module in T7

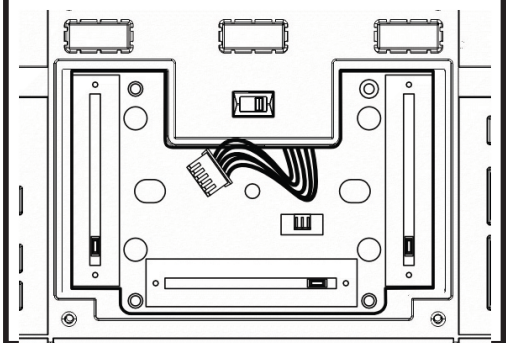


**13** Insert power cable

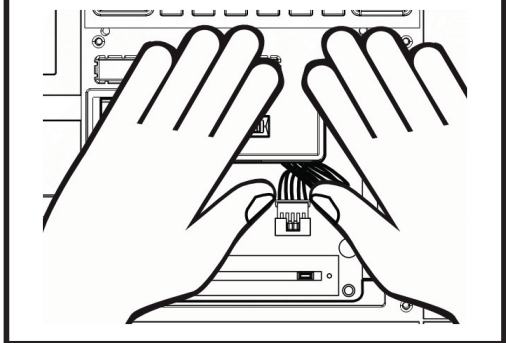


**14** Add 4 philips (cross) screws

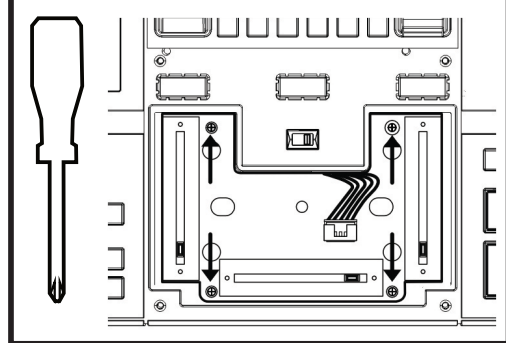


**15** Place the cover

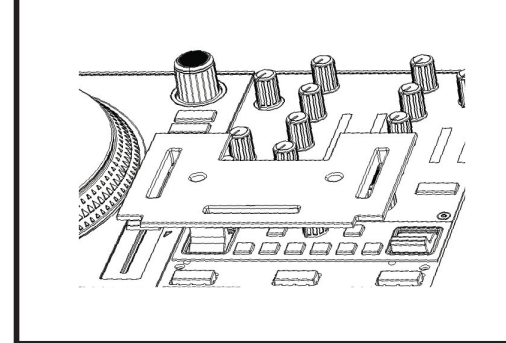

**16** Add 2 philips (cross) screws

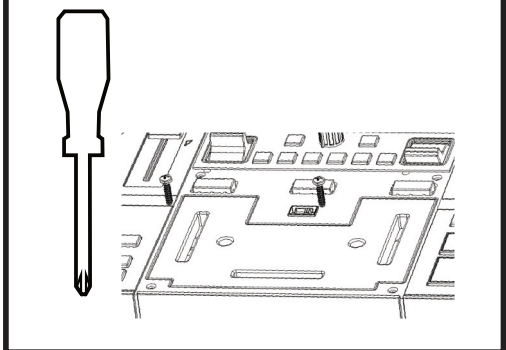

**17** Fix premium plate with 4 torx screws

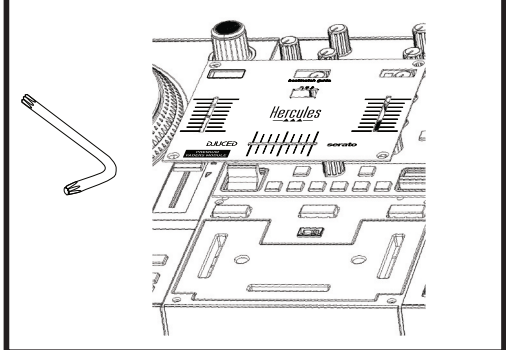

**18** Before calibrating faders

Make sure DJControl Inpulse T7 firmware version is at least 1.87 / Top 1.24

Info in Hercules drivers Control panel > About.

**19** Calibrate faders.

Connect T7 power and USB cables.  
Press down deck 2 **Back** and **Range** keys while you switch on T7 power.  
Release Back & Range keys.

**20** Beatmatch guide key blinks

2 FX keys light on: 1 & 2.

Move both volume faders on top.  
Move crossfader on middle position.

**21** Press Beatmatch guide key once.

2 more FX keys light on: 3 & second 1.

Move the 2 volume faders to min & max position 2 times.  
Move crossfader fully to left + fully to right.

**22** Press Beatmatch guide key once again.

All FX keys are lit.

**The calibration is finished.**

**23** Infos & tutorial on <https://support.hercules.com/T7Maintenance>

